

@mindtouch"

E系列存储阵列报告控制器在实际插入时已被删除

https://kb-cn.netapp.com/on-prem/E-series/Hardware-Kbs/E-series_storage_array_reports_a_controller... Updated: 周五, 11 7月 2025 14:58:28 GMT

适用场景

NetApp E 系列

问题描述

- 控制器实际位于插槽中、控制器机箱指示灯呈琥珀色亮起。
- 受影响控制器上的所有指示灯都将关闭,包括 <u>七段显示器</u>。
- 受影响控制器没有串行输出。
- Recovery Guru报告:
 - Controller Removed
 - Drive Tray Loss of Path Redundancy

'NetApp provides no representations or warranties regarding the accuracy or reliability or serviceability of any information or recommendations provided in this publication or with respect to any results that may be obtained by the use of the information or observance of any recommendations provided herein. The information in this document is distributed AS IS and the use of this information or the implementation of any recommendations or techniques herein is a customers responsibility and depends on the customers ability to evaluate and integrate them into the customers operational environment. This document and the information contained herein may be used solely in connection with the NetApp products discussed in this document.'

1

- Battery Missing
- Volume Not On Preferred Path
- REMOVED CONTROLLER
- DRAWER DEGRADED
- NON PREFERRED PATH
- DRAWER DEGRADED
- REMOVED BATTERY
- WB_CACHING_FORCIBLY_DISABLED
- NO_REDUNDANCY_TRAY
- 主要事件日志显示此模式的多个实例:
 - Temperature sensor removed
 - Controller removed
 - Degraded wide port becomes failed
 - \circ Controller wide port has gone to failed state
 - Drive tray path redundancy lost
 - Dedicated mirror channel failed
 - Start-of-day routine begun
 - Start-of-day routine completed